



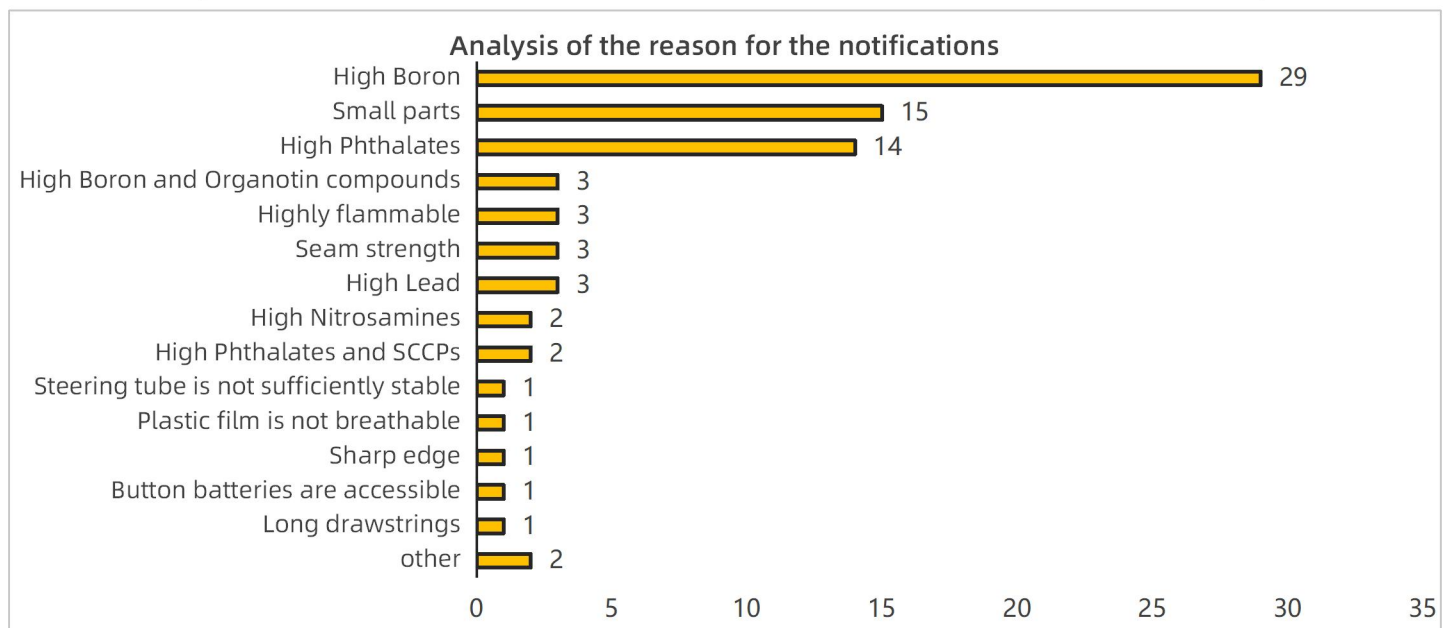

Toy Products Recall Notifications-2024 report 9

In order to protect consumer legitimate rights, the European Union, UK, USA, Canada, Australia together with other countries in the world has established special notification systems to provide information of products which may cause risk to people health and safety.

A total of 69 notifications of children's toys were declared in EU RAPEX are from **Cyprus, Spain, Germany, France, Poland, Czechia, Lithuania, Malta, Croatia, Hungary, Sweden**; 14 notifications in UK official for product safety and Standards website; 2 notifications in Healthy Canadians official website; 0 notification in Australian product safety recalls official website; 3 notifications in CPSC official website from 36 to 39 week of 2024. **Up to 81 notifications of children's toys are from China among all those notifications.** Toys were notified because of the migration of boron from the product is too high, contain or release small parts, phthalates content exceeds the limit level, etc.

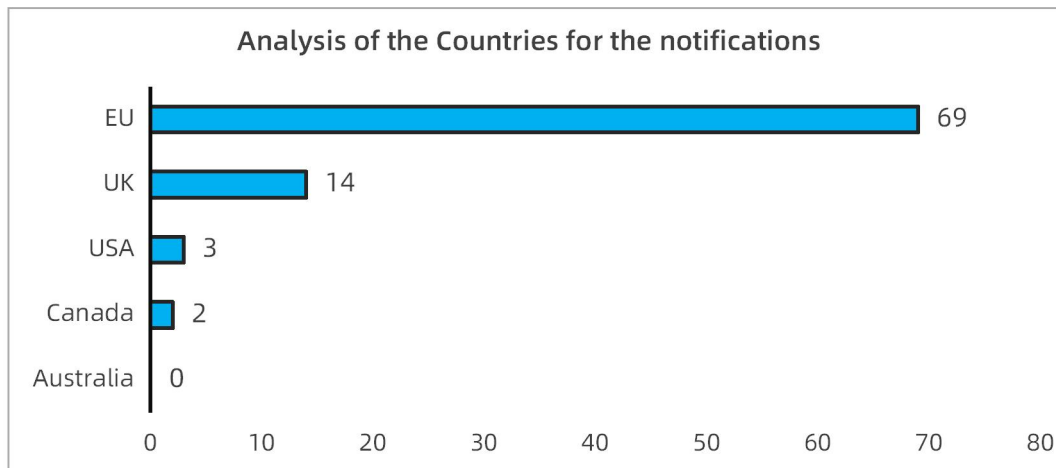



Toy Products Recall Notifications-2024 report 9





| Risk | Notifying country | Regulation/ Standard | Notification count | Products | Partial Pictures |
|---|---|---|--------------------|---|------------------|
| Chemical The migration of boron from the product is too high. | Germany Malta UK | EN 71-3 Toys (Safety) Regulations 2011 | 29 | Toy slime Modelling clay | |
| Choking Contain or release small parts. | Cyprus Spain Lithuania Poland Canada UK | EN 71-1 SOR/2011-17 Toys (Safety) Regulations 2011 | 15 | Toy gun set Puzzle mat Fishing toy set Soft toy Toy rattle Toy set Soother Baby and toddler toy Playpen Finger toy | |
| Chemical Phthalates content exceeds the limit level. | Czechia Poland Hungary Germany Cyprus UK | REACH ANNEX XVII Toys (Safety) Regulations 2011 | 14 | Plastic doll set Plastic doll Toy set Inflatable toy Jumping ball Finger toy Fancy-dress mask Beach ball | |
| Burns The product is highly flammable and non self-extinguishing, creating a risk of burns. | Hungary | EN 71-2 | 3 | Fancy-dress costume Children's fancy dress | |





Toy Products Recall Notifications-2024 report 9

Continue:

| Risk | Notifying country | Regulation/ Standard | Notifica-tion count | Products | Partial Pictures |
|---|-------------------|---|---------------------|--------------|---|
| Chemical The migration of boron and organotin compounds from the product is too high. | Germany | EN 71-3 | 3 | Toy slime |  |
| Choking Contain or release small parts. The seams come easily apart, making the filling accessible. | France Germany | EN 71-1 | 2 | Soft toy |  |
| Chemical The amount of nitrosamines released by the balloons is too high. | Germany UK | Toy Safety Directive Toys (Safety) Regulations 2011 | 2 | Balloons |  |
| Chemical Lead content exceeds the limit level. | USA Canada | ASTM F963 SOR/2011-17 | 2 | Garden Set's |  |





Toy Products Recall Notifications-2024 report 9

Continue:

| Risk | Notifying country | Regulation/ Standard | Notifica- tion count | Products | Partial Pictures |
|---|-------------------|----------------------------------|----------------------|------------------------------|------------------|
| Chemical Environment Phthalates and SCCPs content exceeds the limit level. | Sweden | REACH ANNEX XVII POPs Regulation | 2 | Electric toy Plastic ball | |
| Choking The seams come easily apart, making the filling accessible. | Croatia | EN 71-1 | 1 | Plush toy | |
| Injuries The product had the sharp edges could harm the user or other persons passing in front of the swing. | UK | Toys (Safety) Regulations 2011 | 1 | Swing | |
| Injuries The steering tube of the scooter is not stable enough, which can cause children to lose their balance and fall and injure themselves. The diameter of the front wheel is less than the prescribed 120mm, and the scooter has the risk of ejection after hitting an object. | UK | Toys (Safety) Regulations 2011 | 1 | Toys scooter | |





Toy Products Recall Notifications-2024 report 9

Continue:




| Risk | Notifying country | Regulation/ Standard | Notifica-tion count | Products | Partial Pictures |
|---|-------------------|--------------------------------|---------------------|---|------------------|
| <p>Strangulation</p> <p>The product presents a high risk of strangulation as it possesses drawstrings around the neck area.</p> | UK | Toys (Safety) Regulations 2011 | 1 | Inflatable Toy | |
| <p>Chemical</p> <p>The flashlight battery compartment can be opened without tools, and the button battery is easy to access. A child could put them in the mouth, which could cause damage to the child's gastrointestinal tract or choking.</p> | USA | ASTM F963 | 1 | Bright Builder Fort Kits with Flashlights | |
| <p>Environment</p> <p>Lead content exceeds the limit level.</p> | Sweden | RoHS 2 Directive | 1 | Electrical toy chicken | |





Toy Products Recall Notifications-2024 report 9

Continue:

| Risk | Notifying country | Regulation/ Standard | Notifica-tion count | Products | Partial Pictures |
|--|-------------------|----------------------|---------------------|----------|---|
| Choking Suffocation Contain or release small parts. Plastic film is not breathable, if a child plays with the packaging, the plastic can cover the mouth and nose, causing the child to suffocate. | France | EN 71-1 | 1 | Soft toy |  |
| Burns Choking Contain or release small parts. The toy may overheat and cause burns. | France | EN 71-1 EN 62115 | 1 | Soft toy |  |
| Entrapment Injuries The product has accessible openings and holes, in which children can become trapped and suffer injuries. The swing seat is attached to the rope by knots, which may loosen and cause a child to fall off the swing and be injured. | Poland | EN 71-8 | 1 | Swing |  |

Referenced web:

- <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>
- <https://www.cpsc.gov/Recalls>
- <https://recalls-rappels.canada.ca/en/search/site>
- <https://www.productsafety.gov.au/recalls>
- <https://www.gov.uk/product-safety-alerts-reports-recalls?>

Remark: All pictures above are selected from the referenced web.







玩具产品召回通报预警-2024年第9期

为了保障消费者的合法权益，欧盟、英国、美国、加拿大、澳大利亚等国均建立了专门的预警通报机制，对不合格的玩具产品进行通报。

2024年第36-39周，欧盟RAPEX通报公布的玩具通报案例共69例，来自塞浦路斯、德国、马耳他、克罗地亚、西班牙、法国、波兰、捷克、立陶宛、匈牙利、瑞典；英国产品安全与标准部门官网14例，加拿大卫生部官网2例，澳大利亚产品安全召回官网0例，美国CPSC官网3例。所有的通报案例当中原产国是中国的案例高达81例，涉及的通报原因包括产品的硼迁移量过高，含有或易产生小部件，邻苯二甲酸酯含量超标等。

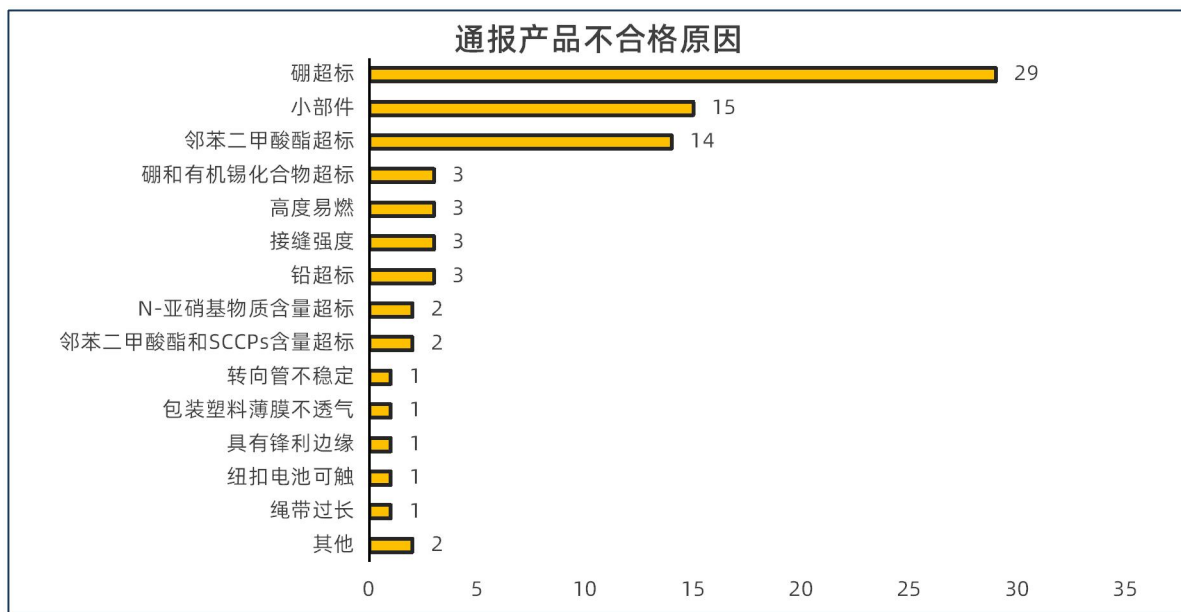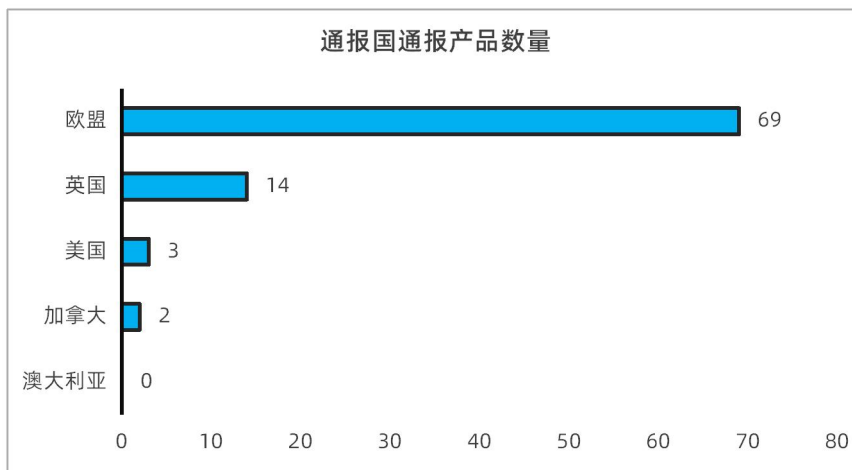



玩具产品召回通报预警-2024年第9期

| 通报原因 | 通报国 | 违反法规/标准 | 通报数量 | 涉及产品 | 部分产品图片 |
|-------------------|---------------------------------------|---|------|---|---|
| 化学 产品的硼迁移量过高。 | 德国 马耳他 英国 | EN 71-3 Toys (Safety) Regulations 2011 | 29 | 玩具史莱姆 造型黏土 |  |
| 窒息 含有或易产生小部件。 | 塞浦路斯 西班牙 立陶宛 波兰 加拿大 英国 | EN 71-1 SOR/2011-17 Toys (Safety) Regulations 2011 | 15 | 玩具枪 拼图垫 钓鱼玩具套装 软体玩具 摇铃玩具 玩具套装 安抚奶嘴 婴幼儿玩具 围栏 指尖玩具 |  |
| 化学 邻苯二甲酸酯含量超标。 | 捷克 波兰 匈牙利 德国 塞浦路斯 英国 | REACH ANNEX XVII Toys (Safety) Regulations 2011 | 14 | 塑料娃娃套装 塑料娃娃 玩具套装 充气玩具 跳跃的球 指尖玩具 化妆舞会面具 沙滩球 |  |

续:





玩具产品召回通报预警-2024年第9期

| 通报原因 | 通报国 | 违反法规/标准 | 通报数量 | 涉及产品 | 部分产品图片 |
|---|----------|---|------|------------------|---|
| <p>烧伤</p> <p>产品易燃烧，并且火焰传播速度过快。</p> | 匈牙利 | EN 71-2 | 3 | 化妆舞会服饰 儿童化装服饰 |  |
| <p>化学</p> <p>产品中硼和有机锡化合物的迁移量超标。</p> | 德国 | EN 71-3 | 3 | 玩具史莱姆 |  |
| <p>窒息</p> <p>含有或易产生小部件，玩具接缝容易裂开，导致填充物可触。</p> | 法国 德国 | EN 71-1 | 2 | 软体玩具 |  |
| <p>化学</p> <p>气球释放的N-亚硝基物质含量太高。</p> | 德国 英国 | Toy Safety Directive Toys (Safety) Regulations 2011 | 2 | 气球 |  |

续：





玩具产品召回通报预警-2024年第9期

| 通报原因 | 通报国 | 违反法规/标准 | 通报数量 | 涉及产品 | 部分产品图片 |
|--|-----------|-------------------------------------|------|-------------|--------|
| 化学 铅含量超标。 | 美国 加拿大 | ASTM F963 SOR/2011-17 | 2 | 花园套装 | |
| 化学 环境 邻苯二甲酸酯和SCCPs含量超标。 | 瑞典 | REACH ANNEX XVII POPs Regulation | 2 | 电动玩具 塑料球 | |
| 窒息 玩具接缝容易裂开，导致填充物可触。 | 克罗地亚 | EN 71-1 | 1 | 毛绒玩具 | |
| 伤害 滑板车的转向管不够稳定，会导致儿童失去平衡并摔伤。前轮的直径低于规定的120mm，滑板车存在撞到物体后弹射的风险。 | 英国 | Toys (Safety) Regulations 2011 | 1 | 玩具滑板车 | |

续：





玩具产品召回通报预警-2024年第9期

| 通报原因 | 通报国 | 违反法规/标准 | 通报数量 | 涉及产品 | 部分产品图片 |
|--|-----|--------------------------------|------|-----------|---|
| <p>伤害</p> <p>该产品具有锋利的边缘，可能会伤害用户或从秋千前经过的其他人。</p> | 英国 | Toys (Safety) Regulations 2011 | 1 | 秋千 |  |
| <p>绞杀</p> <p>产品上的拉绳可能会被卡住并紧紧缠在孩子的脖子上，勒死或伤害他们。</p> | 英国 | Toys (Safety) Regulations 2011 | 1 | 充气玩具 |  |
| <p>化学</p> <p>手电筒电池舱不用工具就能打开，纽扣电池易接触。孩子可能会将它们放入口中，这可能会损坏孩子的胃肠道或窒息。</p> | 美国 | ASTM F963 | 1 | 带手电筒的建筑玩具 |  |
| <p>环境</p> <p>铅含量超标。</p> | 瑞典 | RoHS 2 Directive | 1 | 电动玩具鸡 |  |




续：

| 通报原因 | 通报国 | 违反法规/标准 | 通报数量 | 涉及产品 | 部分产品图片 |
|------|-----|---------|------|------|--------|
|------|-----|---------|------|------|--------|





玩具产品召回通报预警-2024年第9期

| | | | | | |
|--|----|---------------------|---|------|---|
| <p>窒息</p> <p>含有或易产生小部件。塑料薄膜是不透气的，如果孩子玩的包装，塑料可以覆盖嘴和鼻子，造成孩子窒息。</p> | 法国 | EN 71-1 | 1 | 软体玩具 |  |
| <p>烧伤 窒息</p> <p>含有或易产生小部件。玩具可能过热而导致烧伤。</p> | 法国 | EN 71-1 EN 62115 | 1 | 软体玩具 |  |
| <p>诱捕 伤害</p> <p>产品有可进入的开口和孔洞，儿童可能被困住而受伤。秋千座椅的绳结存在松动风险会导致孩子从秋千上掉下来而受伤。</p> | 波兰 | EN 71-8 | 1 | 秋千 |  |

参考网站:

- <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>
- <https://www.cpsc.gov/Recalls>
- <https://recalls-rappels.canada.ca/en/search/site>
- <https://www.productsafety.gov.au/recalls>
- <https://www.gov.uk/product-safety-alerts-reports-recalls?>

备注:以上图片均来自以上参考网站。

