



Textile & Leather & Shoes & Bag Products Recall Notifications - 2025 report 3

In order to protect the legitimate rights and interests of consumers, countries such as the European Union, the United States, Canada and Australia have established special early warning and notification mechanisms to notify substandard products. CTT summarizes the notification information related to textile & leather & shoes & bag products in the third quarter of 2025. During this period, the European Union announced 25 notified cases, the United States announced 5 notified cases, Canada announced 4 notified cases, and Australia announced 2 notified cases, for a total of 36 cases. Among the countries of origin involved, including China, Peru, Bangladesh, Portugal, Spain, India, Turkey and Pakistan, among which 21 cases were related to China, accounting for 58%; The types of risks involved in the recalled products include: rope straps cause injury and strangulation hazard, burn hazard, chemical hazard, suffocation/choking hazard, etc. More details are as follows:

EU RAPEX:

Risk	Regulation / Standard	Notification count	Products
Chemical hazard	REACH POPs RoHS	14	Children's sandals、Wallet、Leather gloves: Chromium(VI) Beanie with LED lamp、Glove with LED lights: Lead Sandals、Children's sandals、T-shirts and sweatshirts: Phthalates(DBP、DEHP) Slippers: PAHs Plastic sandals: Phthalates(DBP) Children's slippers: Phthalates(BBP) Plastic sandals: Lead、Phthalates(DBP、DEHP) Toiletry bag: Cadmium、Phthalates(DEHP)、SCCPs
Rope straps cause injury and strangulation hazard	GPSR GPSD EN 14682	7	Children's clothing set、Children's jacket、Children's hoodie、Children's cardigan、Children's dress
Small parts choking hazard	GPSR EN 71-1	3	Babies' clothing set、Children's jacket
Face covering suffocation hazard	GPSR	1	Baby sleeping bag

United States CPSC:

Risk	Regulation / Standard	Notification count	Products
Burn hazard	16 CFR 1615/1616	4	Children's pajama sets、Children's loungewear
Injury hazard	CPSC	1	Heated socks

Canada HC:

Risk	Regulation / Standard	Notification count	Products
Burn and fire hazard	SOR/2016-169 CCPSA SOR/2016-176	3	Children's pajama sets、Visor with recharging fan、Fluffy area rug
Injury hazard	CCPSA	1	Heated socks

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131



Scan with
WeChat for more
information.

V 2025.04



Australia ACCC:

Risk	Regulation / Standard	Notification count	Products
Small parts choking hazard	ACCC	1	Sleepbag
Choking and health risks	ACCC	1	Infant feeding pillow

Some typical cases are as follows:



Product	Children's jacket
Country of origin	China
Alert submitted by	Lithuania
Risk description	The product has long drawstrings with free ends in the neck area. These drawstrings can become trapped during various activities of a child, leading to strangulation.
Regulation/Standard	GPSR、EN 14682



Product	Babies' clothing set
Country of origin	Unknown
Alert submitted by	Germany
Risk description	Small parts (buttons) can be easily detached from the product. A small child may put them in the mouth and choke.
Regulation/Standard	GPSR



Product	T-shirts and sweatshirts
Country of origin	Pakistan
Alert submitted by	The Netherlands
Risk description	The imprint of the affected clothing items has an excessive concentration of bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values: 25% and 0.12% by weight, respectively). These phthalates may harm the health by causing possible damage to the reproductive system.
Regulation/Standard	REACH



Product	Children's pajama sets
Country of origin	China
Alert submitted by	United States、Canada
Risk description	The recalled children's pajama sets violate the flammability standards for children's sleepwear, posing a risk of burn injuries or death to children.
Regulation/Standard	16 CFR 1615/1616; SOR/2016-169

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192


E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.comScan with
WeChat for more
information.

V 2025.04

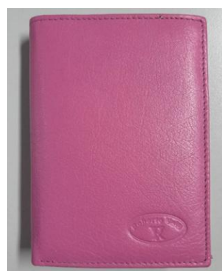

Product	Wallet
Country of origin	India
Alert submitted by	Germany
Risk description	The leather in the product contains chromium VI (measured value: 8.09 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer.
Regulation/Standard	REACH



Product	Baby sleeping bag
Country of origin	Unknown
Alert submitted by	United Kingdom in respect of Northern Ireland
Risk description	The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate.
Regulation/Standard	GPSR



Product	Slippers
Country of origin	China
Alert submitted by	Croatia
Risk description	The plastic of the product has an excessive concentration of polycyclic aromatic hydrocarbons (PAHs), notably Dibenzo[a,h]anthracene (DBA _h A) (measured value 10.8 mg/kg by weight). This PAH may cause cancer.
Regulation/Standard	REACH



Product	Children's slippers
Country of origin	China
Alert submitted by	Sweden
Risk description	The plastic material of the product has an excessive concentration of benzyl butyl phthalate (BBP) (measured value up to 51.2% by weight). This phthalate may harm the health by causing possible damage to the reproductive system.
Regulation/Standard	REACH



Product	Infant feeding pillow
Country of origin	China
Alert submitted by	Australia
Risk description	Baby bottle self-feeding devices pose a possible risk to babies from choking, aspiration pneumonia, suffocation and ear infections.
Regulation/Standard	ACCC

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>
Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com
Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com
Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Scan with
WeChat for more
information.

V 2025.04



Product	Plastic sandals
Country of origin	China
Alert submitted by	Sweden
Risk description	The plastic material of the product has an excessive concentration of lead, bis(2-ethylhexyl) phthalate (DEHP) and dibutyl phthalate (DBP) (measured values: 13%, 11.7% and 9.2% by weight, respectively). These phthalates may harm the health by causing possible damage to the reproductive system. Lead is harmful to human health, accumulates in the body, can cause developmental neurotoxicity and may affect breast-fed or unborn children.
Regulation/Standard	REACH



Product	Glove with LED lights
Country of origin	China
Alert submitted by	Sweden
Risk description	The solders in the product have an excessive concentration of lead (measured value: 69.5% by weight). Lead poses a risk to the environment.
Regulation/Standard	RoHS



Product	Heated socks
Country of origin	Bangladesh
Alert submitted by	United States、Canada
Risk description	The socks can cause pain and discomfort resulting in burns and blisters when worn during high-intensity activities that generate a combination of heat, excessive friction, moisture and pressure, posing an injury hazard.
Regulation/Standard	CPSC: CCPSA

Different markets have different requirements for textiles & leather & shoes & bag products. Therefore, it is particularly important to understand the requirements of export markets for products, especially for children's products, and to design and produce in strict accordance with relevant regulations and standards. Avoid the risk of recalls or claims due to product quality issues.

Referenced web:

<https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>

<https://www.cpsc.gov/Recalls>

<https://recalls-rappels.canada.ca/en/search/site>

<https://www.productsafety.gov.au/recalls>

Remark: All pictures above are selected from the referenced web.

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



Scan with
WeChat for more
information.

V 2025.04



纺织和皮革鞋包类产品召回通报预警—2025年第3期

为了保障消费者的合法权益，欧盟、美国、加拿大和澳大利亚等国家建立了专门的预警通报机制，对不合格产品进行通报。CTT汇总了2025年第三季度纺织和皮革鞋包类产品的通报信息。在该期间，欧盟公布通报案例25例，美国公布通报案例5例，加拿大公布通报案例4例，澳大利亚公布通报案例2例，共36例。所涉及的原产国，包括中国、秘鲁、孟加拉国、葡萄牙、西班牙、印度、土耳其和巴基斯坦，其中与中国相关的有21例，占58%；所涉及的召回产品风险类型，包括：绳带引起受伤和绞勒危害、烧伤危害、有害化学物质超标危害、窒息危害等。更多详情如下：

欧盟 RAPEX:

风险类型	违反法规/标准	通报数量	涉及产品大类
有害化学物质超标危害	REACH POPs RoHS	14	儿童凉鞋、钱包、皮手套：六价铬 带LED灯的针织帽、带LED灯的手套：铅 凉鞋、儿童凉鞋、T恤和运动衫：邻苯二甲酸酯（DBP、DEHP） 拖鞋：多环芳烃 塑料凉鞋：邻苯二甲酸酯（DBP） 儿童拖鞋：邻苯二甲酸酯（BBP） 塑料凉鞋：铅、邻苯二甲酸酯（DBP、DEHP） 洗漱包：镉、邻苯二甲酸酯（DEHP）、短链氯化石蜡
绳带引起受伤和绞勒危害	GPSR GPSD EN 14682	7	童装套装、儿童夹克、儿童连帽衫、儿童开衫、儿童连衣裙
小部件窒息危害	GPSR EN 71-1	3	婴儿服装套装、儿童夹克
蒙面窒息危害	GPSR	1	婴儿睡袋

美国 CPSC:

风险类型	违反法规/标准	通报数量	涉及产品大类
烧伤危害	16 CFR 1615/1616	4	儿童睡衣裤套装、儿童家居服
受伤危害	CPSC	1	加热袜

加拿大 HC:

风险类型	违反法规/标准	通报数量	涉及产品大类
烧伤和起火的危险	SOR/2016-169 CCPSA SOR/2016-176	3	儿童睡衣裤套装、带充电风扇的遮阳帽、毛绒区域地毯
受伤危害	CCPSA	1	加热袜

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东（东莞、深圳、惠州、广州、中山）

TEL: +86(0)769-8898 9888-884

浙江（义乌、宁波）

TEL: 0579-8998 6543

福建（泉州、厦门）

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com




扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



澳大利亚 ACCC:

风险类型	违反法规/标准	通报数量	涉及产品大类
小部件窒息危害	ACCC	1	睡袋
窒息和健康风险	ACCC	1	婴儿喂养枕

部分典型案例如下:

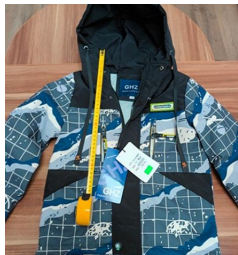

产品	儿童夹克
原产国	中国
通告国	立陶宛
风险描述	该产品在颈部区域有长抽绳且末端没有固定。儿童在进行各种活动时，这些抽绳可能会被缠住，导致窒息危险。
违反法规/标准	GPSR、EN 14682



产品	婴儿服装套装
原产国	未知
通告国	德国
风险描述	小部件（扣子）容易从产品上脱落。小孩子可能会将其放入口中而发生窒息。
违反法规/标准	GPSR



产品	T恤和运动衫
原产国	巴基斯坦
通告国	荷兰
风险描述	衣物上的印花含有过量的邻苯二甲酸二(2-乙基己)酯(DEHP)和邻苯二甲酸二丁酯(DBP)（测量值分别为25%和0.12%按重量计）。这些邻苯二甲酸盐可能会对生殖系统造成损害，从而危害健康。
违反法规/标准	REACH



产品	儿童睡衣裤套装
原产国	中国
通告国	美国、加拿大
风险描述	被召回的儿童睡衣违反了儿童睡衣的易燃性法规，对儿童造成烧伤或死亡的风险。
违反法规/标准	16 CFR 1615/1616; SOR/2016-169

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



产品	钱包
原产国	印度
通告国	德国
风险描述	产品中皮革含六价铬（测量值：8.09 mg/kg）。六价铬具有致敏性，可引发过敏反应，并可致癌。
违反法规/标准	REACH



产品	婴儿睡袋
原产国	未知
通告国	英国北爱尔兰
风险描述	睡袋有一个兜帽，可以盖住婴儿的嘴和/或鼻子。这可能会导致孩子窒息。
违反法规/标准	GPSR



产品	拖鞋
原产国	中国
通告国	克罗地亚
风险描述	该产品的塑料含有过量的多环芳烃(PAHs)，特别是二苯并[a,h]蒽(DBA _h A)（测量值10.8 mg/kg按重量计）。这种多环芳烃可能致癌。
违反法规/标准	REACH



产品	儿童拖鞋
原产国	中国
通告国	瑞典
风险描述	该产品的塑料材料含有过量的邻苯二甲酸苄丁酯(BBP)（测量值高达51.2%按重量计）。这种邻苯二甲酸盐可能会对生殖系统造成损害，从而危害健康。
违反法规/标准	REACH



产品	婴儿喂养枕
原产国	中国
通告国	澳大利亚
风险描述	婴儿喂养枕（自喂装置）可能会对婴儿造成窒息、吸入性肺炎和耳部感染的潜在风险。
违反法规/标准	ACCC

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东（东莞、深圳、惠州、广州、中山）

TEL: +86(0)769-8898 9888-884

浙江（义乌、宁波）

TEL: 0579-8998 6543

福建（泉州、厦门）

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



产品	塑料凉鞋
原产国	中国
通告国	瑞典
风险描述	该产品的塑料材料中铅、邻苯二甲酸二(2-乙基己基)酯(DEHP)和邻苯二甲酸二丁酯(DBP)浓度超标(测量值分别为13%、11.7%和9.2%按重量计)。这些邻苯二甲酸盐可能会对生殖系统造成损害,从而危害健康。铅对人体健康有害,在体内积聚,可引起发育性神经毒性,并可能影响母乳喂养或未出生的婴儿。
违反法规/标准	REACH



产品	带LED灯的手套
原产国	中国
通告国	瑞典
风险描述	产品中的焊料铅浓度过高(测量值:69.5%按重量计)。铅对环境有危害。
违反法规/标准	RoHS



产品	加热袜
原产国	孟加拉国
通告国	美国、加拿大
风险描述	穿着袜子进行高强度活动时可能会引起疼痛和不适,有受伤风险。在产生热量、过度摩擦、湿气和压力的综合作用下,可能会导致灼伤和水泡。
违反法规/标准	CPSC; CCPSA

各个市场对于纺织品及皮革鞋包类产品的要求不尽相同,因此,了解出口市场对产品的要求,尤其是儿童产品的要求,并严格按照相关法规和标准进行设计和生产则显得尤为重要,避免因产品质量问题而导致召回或产生索赔的风险。

参考网站:

<https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>

<https://www.cpsc.gov/Recalls>

<https://recalls-rappels.canada.ca/en/search/site>

<https://www.productsafety.gov.au/recalls>

备注: 以上图片均来自以上参考网站。

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



扫描左侧二维码,
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04